

Oil Filter Replacement


1.4L 4 cylinder engines (RPO: LUV)

Important: This Job Aid applies to:

- 1.4L Engine code LUV
 - Buick Encore, Chevrolet Cruze, Chevrolet Sonic, Chevrolet Trax

Important: These engines are affected by an oil filter and filter housing cap supplier change mid-production. It is critical to confirm the correct oil filter is being used, otherwise the oil filter may be bypassed entirely. The VIN alone is not sufficient for oil filter application confirmation.

ACDelco PF2257G

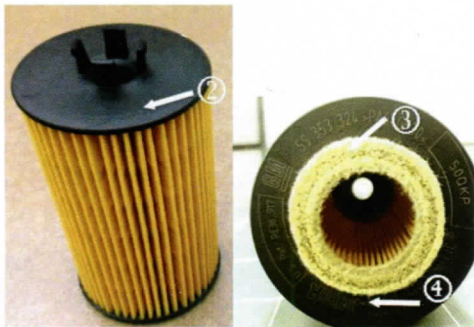

Part number: 55593189

Identification


1. Bypass valve
2. Felt type for bottom plate
3. No ribs
4. Supplier Name: Hengst

WARNING:

In order for correct operation to occur there must be ONE bypass valve in use. For vehicles that do not have the bypass valve built into the housing, use the filter shown on the right.



ACDelco PF2263G

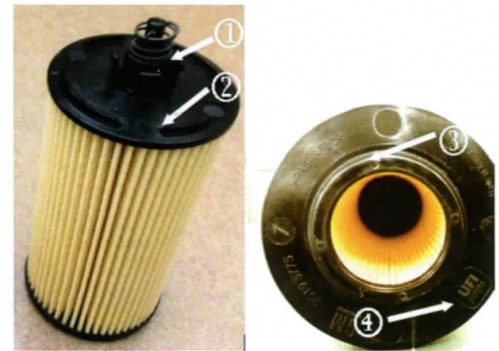

Part number: 25195776

Identification

1. Bypass valve
2. O-ring type for bottom plate
3. 4 X Ribs
4. Supplier Name: UFI

Part number:
55593189

Identification

1. Black
2. Supplier name: Hengst
3. Smooth Circumference

USE PF2257G



Part number:
25195776

Identification

1. Dark brown
2. Supplier name: UFI
3. Ribbed Circumference

USE PF2263G

Note: This material is intended only as a guide. Refer to the appropriate service information for the proper service procedures